



Technical Bulletin 00210

www.jcm-american.com

Next time you're surfing the net, make sure to visit our improved website featuring **information on issuance of the NexGen bills**, a photo parts catalog, online ordering form, repair service, and more.

Parts are Parts



Part No. 035237

Description: Harness, Stacker Relay

Usage: This harness relays the communication signals between the sensors located in the transport and the CPU board located in the DBV-14X or DBV-200 bill validator heads.

Note: This harness can be broken if it is not properly disconnected before removing the bill validator head from the transport assembly. If the harness has been improperly removed, check the wiring in the harness for fraying or disconnection. Also, check the solder points on the connector plugs to make sure there are no cold solder joints or cracks.

JCM Latest Software Listing

| Unit | ID | Version | Chksums |
|---------------------|--------------|--------------|---------|
| WBA-10-SS | ID-003 | V-2.07-17 | FD87 |
| WBA-10-SS | ID-022/023 | V-2.07-03 | CED2 |
| WBA-10-SS | ID-024 | V-2.07-10 | 9388 |
| WBA-11-SS | ID-003 | V-2.07-17 | FD87 |
| WBA-11-SS | ID-022/023 | V-2.07-03 | CED2 |
| WBA-11-SS | ID-024 | V-2.07-10 | 9388 |
| WBA-12-SS | ID-003 | V-2.07-17 | 85D3 |
| WBA-12-SS | ID-0C3 | V-2.07-08 | 09DF |
| WBA-12-SS | ID-022/023 | V-2.13-03 | AD45 |
| WBA-12-SS | ID-044C | V-2.07-05 | F32C |
| WBA-12-SS | ID-044 | V-2.07-05 | F0F5 |
| WBA-12-SS | ID-023B | V-2.08-04 | 928B |
| WBA-12-SS | ID-024 | V-2.13-10 | 5FEC |
| WBA-13-SS | ID-003 | V-2.07-17 | 85D3 |
| WBA-13-SS | ID-0C3 | V-2.07-08 | 09DF |
| WBA-13-SS | ID-022/023 | V-2.13-03 | AD45 |
| WBA-13-SS | ID-044C | V-2.07-05 | F32C |
| WBA-13-SS | ID-044 | V-2.07-05 | F0F5 |
| WBA-13-SS | ID-023B | V-2.08-04 | 928B |
| WBA-13-SS | ID-024 | V-2.13-10 | 5FEC |
| DBV-200-B0/B1 | ID-022/023 | V-2.33-04-03 | B37B |
| DBV-200-A2/A3 | ID-004/BAR | V-2.30-05 | DB99 |
| DBV-200-A2/A3 | ID--44P/045P | V-2.30-05 | 19FA |
| DBV-200-A2/A3 | ID-011/015 | V-2.30-09 | F214 |
| DBV-200-A2/A3 | ID-044/045W | V-2.33-04 | 3C58 |
| DBV-200-B4/B5 | ID-024 | V-2.30-09 | 9774 |
| DBV-200-B1,B2,B4,B5 | ID-003 | V-2.31-02 | DE2A |

The list of JCM bill validator software provided herein notifies customers of the latest versions developed. However, the listing does not identify versions approved by gaming jurisdictional authorities for actual use. Customers should consult JCM's Customer Service/Parts Sales departments concerning approved versions for jurisdictions of intended use.

NOW AVAILABLE for select WMS, Atronic, Summit, CDS, & VLC Machines!

SENTRY™ is the latest product released by JCM. SENTRY is a smart bill entry with LED icons displaying up to six acceptable denominations plus barcode and last bill entry. There are also five error icons and a cashbox full indicator. Easy to retrofit to your machines, SENTRY offers features appealing to both players and operators. Contact your local JCM sales representative for additional information.





FREE REGIONAL TRAINING
 Give your techs the tools they need to keep your customers happy and your equipment running at peak efficiency.

October
 October
 November

Kansas City, Missouri
 Dover, Delaware
 Reno, Nevada

Customer Notification/Tech Tips:

Product: WBA-XX units

Occurance: Rare

Mandatory Upgrade: None Required

Issue: The WBA-XX frame has two tabs located on the inside bottom corners. These tabs help guide the cash box into proper alignment during the drop process. It is possible that a cash box can be seated with enough force to bend the tabs out of alignment. This can cause a loud gear skipping noise, or cause the transport motor to run continuously until the unit reaches an error condition.



Resolution: Adjust the tabs back into proper alignment using a pair of curved, long-nose pliers. Adjust the tabs so that the riding surface is about 10 degrees above level.

JCM and SENTRY are either registered trademarks or trademarks of JCM American. All other product names mentioned herein may be registered trademarks or trademarks of their respective companies. Furthermore, TM and ® are not mentioned in each case in this publication

JCM American Corporation
 925 Pilot Road
 Las Vegas, NV 89119
 Telephone: (702) 651-0000
 Toll Free: (800) 683-7248
 FAX (702) 651-0003
 www.jcm-american.com

