



Notification No.:	20081113	Revision: 1.0	Page: 1 of 2
Release Date:	Nov 13, 2008		
Notification Status:	☐ Advisory	☐ Mandatory	☒ Announcement
Classification:	☐ Firmware	☒ Hardware	☐ Policy/Procedure
Description:	UBA Frame Modification		
Hardware:	UBA all models		
Interface:	n/a	Check Sum:	n/a
Firmware Version(s):	n/a	CRC (seed = 0000):	n/a

Conditions:

JCM Engineering has identified a condition where excessive forceful insertion of a cashbox into a UBA frame can cause damage to the TR stand.

Resolution:

JCM Engineering has developed a modification for the base of frames used in the UBA units. The original base plate has two supports at the rear (Refer to Figure 1). The frame modification has two added supports at the front of the base plate (Refer to Figure 2). This helps to support and properly align the cashbox when it is inserted into the frame. The new base plate is shown installed in the frame. (Refer to Figure 3).

Frame Base

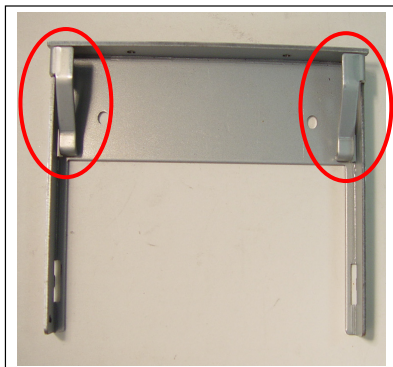


Figure 1

New Frame Base

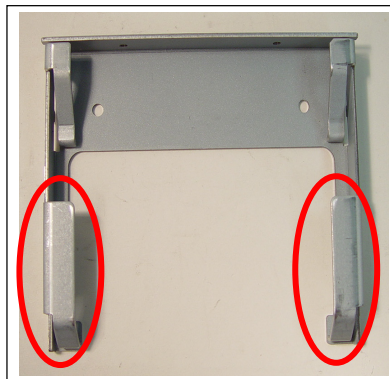


Figure 2

Installed In Frame



Figure 3



Customer Notification



Notification No.:	20081113	Revision: 1.0	Page: 2 of 2
Release Date:	Nov 13, 2008		
Notification Status:	☐ Advisory	☐ Mandatory	☒ Announcement
Classification:	☐ Firmware	☒ Hardware	☐ Policy/Procedure
Description:	UBA Frame Modification		
Hardware:	UBA all models		
Interface:	n/a	Check Sum:	n/a
Firmware Version(s):	n/a	CRC (seed = 0000):	n/a

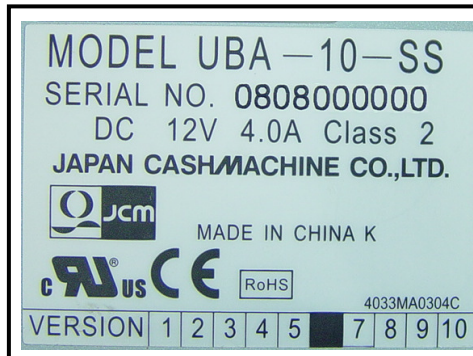


Figure 4.

This modification will become standard on all production units beginning in August, 2008. (Serial numbers 0808XXXXXX) (Refer Fig. 4)

Notes:

The intent of this announcement is to accurately reflect information available at the time of this writing. This information can change or be modified at any time with no formal notification requirements. Please contact your local JCM Sales Representative or JCM Customer Service at (800) 683-7248 for additional information.