




Technical Bulletin 00206

www.jcm-american.com

Next time you're surfing the net, make sure to visit our improved website featuring technical information, a photo parts catalog, and online form ordering of parts, repair service, and more.

Parts are Parts

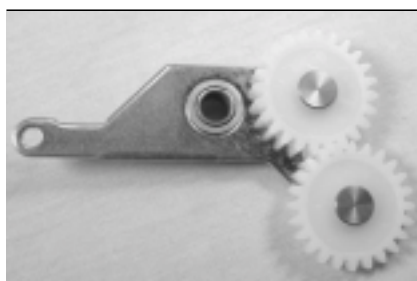

Part No. 051992

Description: Gear Arm Unit, U-PH-06

Usage: This gear arm unit is used on the DBV-14X and DBV-200 SS style transports only. This gear drives the cash box stacking mechanism.

Note: The plastic gears on this unit can be broken when the transport is improperly inserted or removed. Press down the extraction lever during transport removal, disengaging the gear arm unit from the cash box. The extraction lever should remain in the down position during transport insertion to prevent damage to the teeth. While performing normal preventative maintenance, it is important to see if teeth are missing on the gears, because missing teeth can cause a timing or stacking error.

JCM Latest Software Listing

Unit	ID	Version	CHKSUM
WBA-10-SS	ID-003	V-2.07-17	FD87
WBA-10-SS	ID-022/023	V-2.07-03	CED2
WBA-10-SS	ID-024	V-2.07-10	9388
WBA-11-SS	ID-003	V-2.07-17	FD87
WBA-11-SS	ID-022/023	V-2.07-03	CED2
WBA-11-SS	ID-024	V-2.07-10	9388
WBA-12-SS	ID-003	V-2.07-17	85D3
WBA-12-SS	ID-0C3	V-2.07-08	09DF
WBA-12-SS	ID-022/023	V-2.07-03	CDF8
WBA-12-SS	ID-044C	V-2.07-05	F32C
WBA-12-SS	ID-044	V-2.07-05	F0F5
WBA-12-SS	ID-023B	V-2.08-04	928B
WBA-12-SS	ID-024	V-2.07-10	47B5
WBA-13-SS	ID-003	V-2.07-17	85D3
WBA-13-SS	ID-0C3	V-2.07-08	09DF
WBA-13-SS	ID-022/023	V-2.07-03	CDF8
WBA-13-SS	ID-044C	V-2.07-05	F32C
WBA-13-SS	ID-023B	V-2.08-04	928B
WBA-13-SS	ID-044	V-2.07-05	F0F5
WBA-13-SS	ID-024	V-2.07-10	47B5
DBV-200-B0/B1	ID-022/023	V-2.33-04-03	B37B
DBV-200-A2/A3	ID-004/BAR	V-2.30-05	A3C0
DBV-200-A2/A3	ID-044P/045P	V-2.31-05	0BBF
DBV-200-A2/A3	ID-011/015	V-2.30-09	F214
DBV-200-A2/A3	ID-044/045W	V-2.33-04	3C58
DBV-200-B4/B5	ID-024	V-2.30-09	9774
DBV-200-B0,B1,B4,B5	ID-003	V-2.31	E7FA

The list of JCM bill validator software provided herein notifies customers of the latest versions developed. However, the listing does not identify versions approved by gaming jurisdictional authorities for actual use. Customers should consult JCM's Customer Service/Parts Sales departments concerning approved versions for jurisdictions of intended use.

NOW AVAILABLE for select WMS, Atronic, Summit, CDS, & VLC Machines!

SENTRY™ is the latest product released by JCM. SENTRY is a smart bill entry with LED icons displaying up to six acceptable denominations plus barcode and last bill entry. There are also five error icons and a cashbox full indicator. Easy to retrofit to your machines, SENTRY offers features appealing to both players and operators. Contact your local JCM sales representative for additional information.





FREE REGIONAL TRAINING
 Give your techs the tools they need to keep your customers happy and your equipment running at peak efficiency.

June Ledyard, CT
 July Bossier City, LA
 July Atlantic City, NJ
 August New Mexico

Call for reservations 800-683-7248

Customer Notifications/Tech Tips

SECOND NOTICE

Product: DBV-200 units


Occurance: Rare

Mandatory upgrade: None required


Issue: During the manufacturing process, the DBV-200 units' optical lenses are compression-fitted in place. It is possible for the lenses to be displaced during cleaning or clearing a bill jam. This displacement would cause the following condition:

Error conditions 7 and 14 will increase because the lens functions as a prism. As the sensor light passes through the lens, it is partially refracted, causing improper passage.

Resolution: The lenses can be pushed back into proper positions by disassembling the DBV-200 head and resetting the lenses. The procedure will take approximately 3 minutes for the top shelf lenses, and approximately 10 minutes for the bottom shelf lenses.

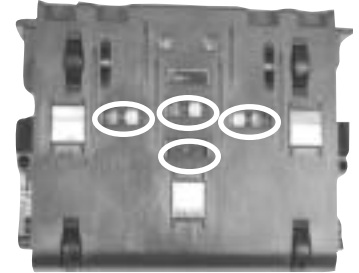

TOP SENSORS

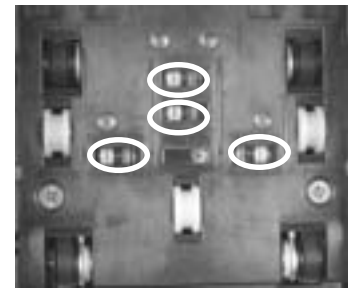

BOTTOM SENSORS

JCM and SENTRY are either registered trademarks or trademarks of JCM American. All other product names mentioned herein may be registered trademarks or trademarks of their respective companies. Furthermore, TM and ® are not mentioned in each case in this publication

JCM American Corporation
 925 Pilot Road
 Las Vegas, NV 89119
 Telephone: (702) 651-0000
 Toll Free: (800) 683-7248
 FAX (702) 651-0003
 www.jcm-american.com

