




Technical Bulletin 00208

www.jcm-american.com

Next time you're surfing the net, make sure to visit our improved website featuring **information on issuance of the NexGen bills**, a photo parts catalog and online ordering form, repair service, and more.

Parts are Parts

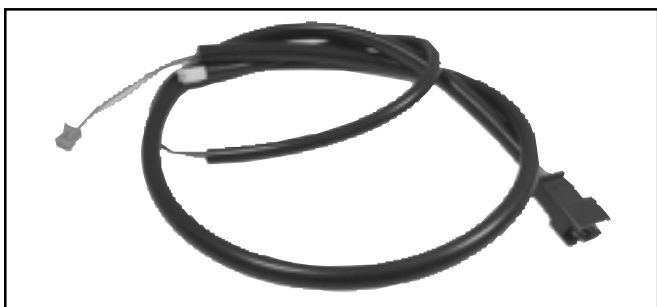

Part No. 035236

Description: Harness, LED

Usage: This harness provides the DBV-14X and the DBV-200 SS bill acceptors with information regarding the cash box status.

Note: The harness transmits information from the cash box sensors to the DBV CPU board through the interface board on the side of the transport. The sensors, located on the frame, monitor the Cash Box stacker position, and if the Cash Box is present. This harness is subject to breaking when it is not connected or routed properly, and it gets pinched inside the machine door.

JCM Latest Software Listing

Unit	ID	Version	ChkSums
WBA-10-SS	ID-003	V-2 07-17	FD87
WBA-10-SS	ID-022/023	V-2 07-03	CED2
WBA-10-SS	ID-024	V-2 07-10	9388
WBA-11-SS	ID-003	V-2 07-17	FD87
WBA-11-SS	ID-022/023	V-2 07-03	CED2
WBA-11-SS	ID-024	V-2 07-10	9388
WBA-12-SS	ID-003	V-2 08-17	1D08
WBA-12-SS	ID-0C3	V-2 07-08	09DF
WBA-12-SS	ID-022/023	V-2 13-03	AD45
WBA-12-SS	ID-044C	V-2 07-05	F32C
WBA-12-SS	ID-044	V-2 07-05	F0F5
WBA-12-SS	ID-023B	V-208-04	928B
WBA-12-SS	ID-024	V-2 13-10	5FEC
WBA-13-SS	ID-003	V-2 07-17	85D3
WBA-13-SS	ID-0C3	V-2 07-08	09DF
WBA-13-SS	ID-022/023	V-2 07-03	CDF8
WBA-13-SS	ID-044C	V-2 07-05	F32C
WBA-13-SS	ID-023B	V-208-04	928B
WBA-13-SS	ID-044	V-2 07-05	F0F5
WBA-13-SS	ID-024	V-2 07-10	47B5
DBV-200-B0/B1	ID-022/023	V-2.33-04-03	B37B
DBV-200-A2/A3	ID-004/BAR	V-2 30-05	DB99
DBV-200-A2/A3	ID-044P/045P	V-2 31-05	06BF
DBV-200-A2/A3	ID-011/015	V-2 30-09	F214
DBV-200-A2/A3	ID-044/045W	V-2 33-04	3C58
DBV-200-B4/B5	ID-024	V-2 30-09	9774
DBV-200-B1,B2,B4,B5	ID-003	V-2 31-02	DE2A

The list of JCM bill validator software provided herein notifies customers of the latest versions developed. However, the listing does not identify versions approved by gaming jurisdictional authorities for actual use. Customers should consult JCM's Customer Service/Parts Sales departments concerning approved versions for jurisdictions of intended use.

NOW AVAILABLE for select WMS, Atronic, Summit, CDS, & VLC Machines!

SENTRY™ is the latest product released by JCM. SENTRY is a smart bill entry with LED icons displaying up to six acceptable denominations plus barcode and last bill entry. There are also five error icons and a cashbox full indicator. Easy to retrofit to your machines, SENTRY offers features appealing to both players and operators. Contact your local JCM sales representative for additional information.





FREE REGIONAL TRAINING
 Give your techs the tools they need to keep your customers happy and your equipment running at peak efficiency.

August
 September
 September
 October

Redding, CA
 Wisconsin
 Minnesota
 Kansas City, MO.

Customer Notifications/Tech Tips

Question: What is a CRC mismatch on an IGT machine?

Answer: A CRC mismatch can occur on any IGT machine that uses their ID-024 (NetPlex) protocol. A CRC mismatch is caused by a change in the validator software which results in the IGT machine making a different CRC calculation on the JCM bill validator software. Some versions of the IGT game software disable the validator without displaying an indication message, while other versions of IGT game software disable the validator and display a CRC mismatch message.



To reactivate the validator on a Game King, you must:

- Enter the IGT Game test menu.
- Press the Setup icon.
- Press the Machine Options icon.
- Press the Bill Validator Options icon.
- Press the Clear Val. CRC Mismatch icon.
- Press the Clear Mismatch icon, and the machine will automatically finish the process. If you do not get this icon, open and close the main door completely, or power down/power up the machine, then start the procedure again from the beginning.

JCM and SENTRY are either registered trademarks or trademarks of JCM American. All other product names mentioned herein may be registered trademarks or trademarks of their respective companies. Furthermore, TM and ® are not mentioned in each case in this publication

JCM American Corporation
 925 Pilot Road
 Las Vegas, NV 89119
 Telephone: (702) 651-0000
 Toll Free: (800) 683-7248
 FAX (702) 651-0003
 www.jcm-american.com

