



Technical Bulletin 201105

www.jcmglobal.com

The JCM Global Website provides the tools required to service all of our products. This includes a Software information database containing DIP Switch information, Customer Notifications, Product Manuals, Diagnostic Applications and more.

Parts are Parts



Part No. 8i8-00006R

Description: iVIZION 1000 Note Cash Box with ICB
Usage: The 1000 Note version of the iVIZION Cash Box is equipped with an ICB memory Unit. The Unit uses a Rail System instead of Pins to align the Cash Box in the Frame Assembly for more support. The iVIZION also uses direct drive gear-to-gear to the Cash Box to prevent slippage, and contains heavier gears to prevent breakage. A visual Indicator Window is also present to display the amount of Banknotes within the Cash Box. The Cash Box Door features recessed lock ports to allow a box to sit flat on a Count-room collection cart; and the inside surface of a lock port is flush to provide easier lock installation without specialized tools.

Note: If a Cash Box ICB Module is accidentally activated, it can be disabled by the JCM Tool Suite Program Utility.

Save Time and Labor with JCM's Intelligent Cash Box System

The ICB® (Intelligent Cash Box) system is a unique cash management system that allows the operator to track a Cash Box and its contents through the entire cash process. The ICB system eliminates the need for dedicating Cash Boxes to specific machines, or putting barcode identification labels on the Cash Boxes. The Cash Boxes are tracked electronically eliminating most variance issues, and with the custom reports provided to each department, accuracy and efficiency is greatly improved.



Latest JCM Software Listing

UNIT	Country	ID*	Version†	Check Sum	CRC
UBA-10/11-SS	USA	ID-003	V2.06-21	028E	
UBA-10/11-SS	USA	ID-024	V2.06-17	7E99	
UBA-14/24-SS/SU	USA	ID-003	V-2.06-21		7BAA
UBA-14/24-SS/SU	USA	ID-0G8*	V-2.06-66		F67E
UBA-14-SS & UBA-24-SS/SU	USA	ID-024	V2.06-28		EE8D
UBA-14-SS & UBA-24-SS/SU	USA	ID-028*	V2.06-18	AEC9	A6F0
UBA-25-SS/SU	USA	ID-024*	V2.05-28	2CB2	
UBA-25-SS/SU	USA	ID-028*	V2.06-18	05D6	
WBA-12/13-SS	USA	ID-003	V-3.80-32i†	0ABC	
WBA-12/13-SS	USA	ID-044*	V-3.75-05i†	D716	
WBA-12/13-SS	USA	ID-024*	V-3.80-34	D1F3	
UBA-10/11-SS	EUR	ID-003*	V-2.05-24	80DC	
UBA-10/11-SS	SWE	ID-003*	V-2.05-20	A3E5	95B2
UBA-10/11-SS	ZAF	ID-003	V-2.05-20	E57F	2F46
UBA-10/11/12-SS	BWA	ID-003*	V-1.96-20	D605	3342
UBA-10/11/12-SS	BGR	ID-003*	V-2.05-20	DA20	21D1
UBA-10/11/12-SS	NAM	ID-003*	V-2.05-20	D12C	A4C1
UBA-10/11/12-SS	TUR	ID-003*	V-1.98-24	557D	C07D
UBA-10/11/12-SS	DNK	ID-003	V-2.07-24	84B2	
UBA-10/11/12-SS	DNK+EUR	ID-003E*	V-2.06-24	4024	
UBA-10/11/12-SS	BIH	ID-003*	V-2.05-20	88F1	D73A
UBA-14-SS & UBA-24-SS/SU	EUR5	ID-003*	V-1.95-20		2BB1
UBA-14-SS & UBA-24-SS/SU	ZAF	ID-003*	V-2.05-20	C3AC	0653
UBA-14-SS & UBA-24-SS/SU	GBR+SCO	ID-003*	V-2.05-20	DBC7	8FE5

* . an asterisk signifies this ID# does not appear on the JCM Web Site.

† . an "i" suffix indicates Intelligent Cash Box Option compatibility.

The list of JCM Banknote Validator Software provided herein notifies Customers of the latest Software Versions developed. However, the listing does not identify Versions approved by Gaming Jurisdictional Authorities for actual use. Customers should always consult the JCM's Parts Sales Departments concerning approved Versions for use in their specific jurisdictions intended for operation.

Current Service Manuals

Product	Revision	Product	Revision
DBV-30X	4	TSP-02	B
EBA-03	2	UBA 10/11/14/24/25	3
ICB	3	WBA-1X/2X	1
Tiako (PUB-7/11)	1	iVIZION	A



FREE REGIONAL TRAINING

Give your technicians the tools they need to keep your customers happy and your equipment running at peak efficiency.

For the local and regional training schedule visit:

<http://www.jcmglobal.com>

Technical Bulletin 201105 May 2011

Technical Tips


Question: How is the Cash Box size determined by the iVIZION Validator?

Answer: The iVIZION Validator automatically determines the size of the Cash Box through the use of a Sensor located on the bottom of the iVIZION Transport Unit ① & ②. This Sensor has an LED and a Photo-Optic Array that uses a Prism ③ mounted on the top of the particular Cash Box to determine the size of the Cash Box. This feature allows the Validator to report the Cash Box size to the Game in which the iVIZION Validator is installed.

Other Sensors located on the Cash Box include the Pusher Home Sensor ④, and the Cash Box Near Full Sensor ⑤.

The Cash Box Pusher Home Sensor tells the Validator when a Banknote can be transported to the Cash Box. When the Pusher Mechanism is not in the Home position, the Banknote path is blocked, and a Banknote cannot be carried into the Cash Box.

The Near Full Indicator (see illustration on Front Side) provides an augmentation to the Validators Software Counter which provides an approximate 75% full indication when activated.

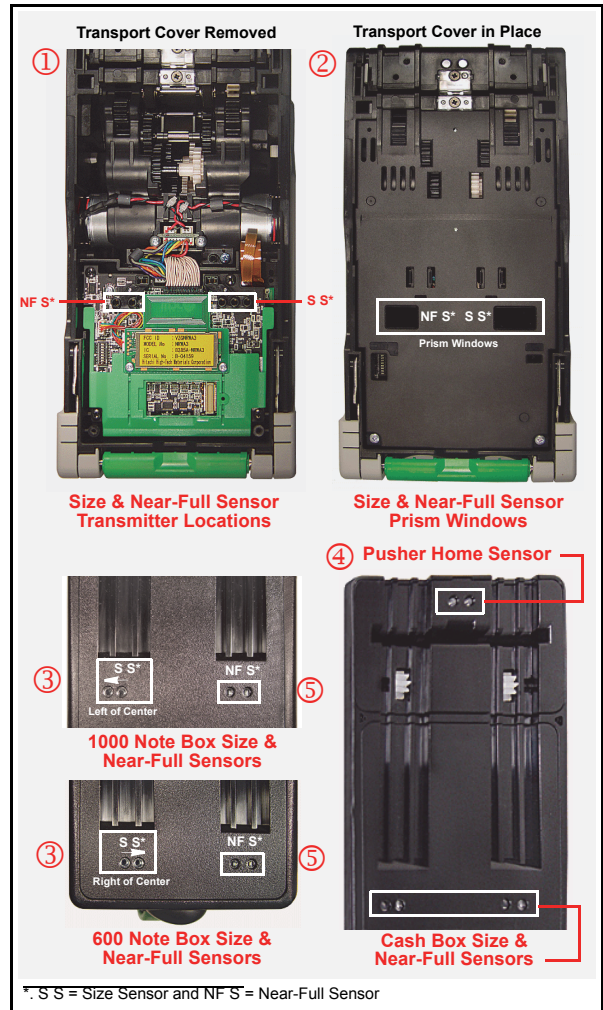

iVIZION Validator & Cash Box Sensor Locations



JCM TECHNICAL SUPPORT CONTACTS

Headquarters (Japan)

Sales and Service | 81-6-6703-8405 | hq-jp@jcmglobal.com

Europe, Africa, Russia, Middle East

Sales and Service | 49-211-530645-0 | hq-eu@jcmglobal.com

Australia, Oceania

Sales and Service | 61-2 9648 0811 | ipayne@jcmglobal.com

Southeast Asia

Sales and Service | 853 28 72 2648 | jim.teng@jcmglobal.com

North/South America/Canada/Caribbean

Toll Free Product Support | (800) 683-7248 or (702) 651-0000 | techsupport@jcmglobal.com

After Hours America's Support

JCM American prides itself in offering the best Customer Service in the industry. We prove this by offering a 24 hour hotline, where Technical Support Personnel can be reached at any time, 7 days a week. To reach our 24/7 after hour's hotline, just follow these three easy steps:
 1.) Call JCM American at (800) 683-7248. 2.) Select "Option 5" and wait for the call to be transferred to the JCM after hour's Technical Support line.
 3.) Speak with a certified JCM support technician about your situation.

JCM is a registered trademark of JCM American Corporation. All other product names mentioned herein may be registered trademarks or trademarks of their respective companies. Furthermore, TM and ® are not mentioned in each case in this publication.