



Technical Bulletin 201311

www.jcmglobal.com

For the latest updates on JCM Global products, services, and events, follow JCM Global on Facebook®, Google®, LinkedIn®, Twitter™, and YouTube™



facebook.com/JCMglobal twitter.com/jcmglobal
 Gplus.to/JCMglobal youtube.com/jcmglobal
 linkedin.com/company/jcm-global

Parts are Parts

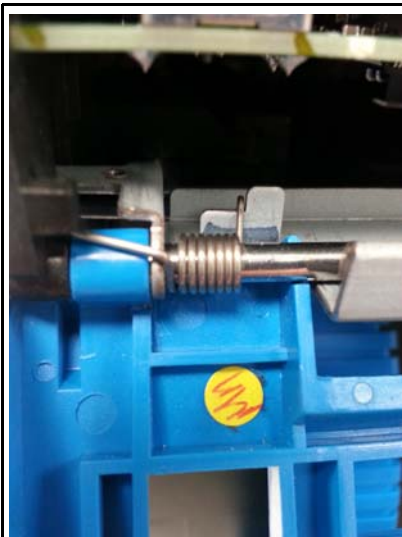


Figure 1: UBA® Transport Spring Latch

Part No. 250-100511

Description: UBA® Transport Spring Latch

Usage: The UBA® Transport Spring Latch ensures that the UBA Transport is latched and secured into the Frame. When properly installed, the Transport Latch Spring should appear as shown in **Figure 1**.

Note: If the Transport Spring Latch is not installed properly after removal and reinstallation of the front cover or CPU, the UBA will “kick” out of the Frame when the Stacker Motor begins stacking banknotes.

Latest JCM Software Listing

UNIT	Country	ID	Version	Check Sum	CRC
UBA-10/11-SS	USA	ID-003	V-2.51-49	DB4C	1C04
UBA-10/11-SS	USA	ID-024	V-2.51-23	04E9	A0A3
UBA-14/24-SS/SU	USA	ID-003	V-2.51-36		BE96
UBA-14/24-SS/SU	USA	ID-0G8	V-2.51-72		EAEF
UBA-14/24-SS/SU	USA	ID-024	V-2.51-34		39B7
UBA-14/24-SS/SU	USA	ID-028	V-2.51-24		6B9D
iVIZION-100 SS/SU	USA	ID-003	V-2.07-29		C65A
iVIZION-100 SS/SU	USA	ID-024	V-2.07-14		C216
iVIZION-100 SS/SU	USA	ID-028	V-2.07-27		8397
iVIZION-100 SS/SU	USA	ID-0G8	V-2.07-23		BBA5
UBA-10/11-SS	CAN	ID-003	V-2.52-50	A372	1455
UBA-10/11-SS	CAN	ID-024	V-2.52-23	71D3	C36F
UBA-14/24-SS/SU	CAN	ID-003	V-2.52-37	959B	B001
UBA-14/24-SS/SU	CAN	ID-024	V-2.52-34		3F71
UBA-14/24-SS/SU	CAN	ID-028	V-2.52-24		B094
UBA-14/24-SS/SU	CAN	ID-0G8	V-2.52-72		AEA1
iVIZION-100 SS/SU	CAN	ID-003	V-2.06-29		FBBC
iVIZION-100 SS/SU	CAN	ID-024	V-2.05-14		51A7
iVIZION-100 SS/SU	CAN	ID-028	V-2.05-27		04BA
iVIZION-100 SS/SU	CAN	ID-0G8	V-2.05-23		BB30

The Latest JCM Software Listing (shown above) does NOT identify the JCM Banknote Validator Software version that has been approved by Gaming Regulators and Jurisdictional Authorities for use in specific gaming jurisdictions. Please contact your local JCM Sales Representative at (800) 683-7248 to verify the correct software version approved for use in your specific gaming jurisdiction.

Current Service Manual Releases

Product	Rev.	Product	Rev.
BlueWave DX (German)	A	iVIZION	4
DBV-30X	4	Taiko (PUB-7/11)	4
DT-200 BlueWave 2	5	TBV	1
EBA-3X	4	TBV-101-ASH	A
ICB Service Manual	4	UBA 10/11/14/24/25	3b
ICB Web Reports Ops Manual	1	UBA-RC	A
iPRO	A	VEGA	2
iPRO-RC	A	VEGA-RC	2
RC-10 Service Manual	1	PayCheck 4 Owner's Manual	A
JCM Tool Suite	2	PayCheck 4 Technician's Manual	A

Save Time and Labor with JCM's Latest Intelligent Cash Box System

The ICB® (Intelligent Cash Box) system is a unique cash management system that allows the operator to track a Cash Box and its contents through the entire cash process. The ICB system eliminates the need for dedicating Cash Boxes to specific machines, or putting bar code identification labels on the Cash Boxes. The Cash Boxes are tracked electronically, eliminating most variance issues, and with the custom reports provided to each department, accuracy and efficiency are greatly improved.





FREE REGIONAL TRAINING

Give your technicians the tools they need to keep your customers happy and your equipment running at peak efficiency.

For the local and regional training schedule, visit:

<http://www.jcmglobal.com>

Technical Bulletin 201311 November 2013

Technical Tips

Question: What is the best way to train my staff about the new Canadian \$5.00 and \$10.00 bills?

Answer: The Bank of Canada website (<http://www.bankofcanada.ca/banknotes/bank-note-series/polymer/>) has the latest information on the New Canadian \$5.00 and \$10.00 polymer Banknote Release, and the facts you'll need to keep your staff members informed, and your property protected against potential fraud. Information about the previously-released \$100.00, \$50.00, and \$20.00 polymer notes is also available.

Note: See the table in the next column for details about integration of the new \$5.00 and \$10.00 polymer banknotes (Figures 2 and 3) into JCM product line firmware.

For more information, contact your local JCM Sales Representative at (800) 683-7248.

Polymer \$5/\$10 Firmware Matrix

Protocol	Polymer \$5 and \$10 added in Version	Latest Released Version	New Release to OEMs
iVIZION			
ID-003	2.01-28	2.02-28	2.06-29
ID-003AS	2.01-28	2.02-28	2.05-29
ID-024	2.01-14	2.02-14	2.05-14
ID-028	2.01-27	2.02-27	2.05-27
ID-0G8	2.01-23	2.02-23	2.05-23
UBA-10			
ID-003	2.51-50	2.52-50	
ID-024	2.51-23	2.52-23	
UBA-14/24			
ID-003	2.51-37	2.52-37	
ID-024	2.51-34	2.52-34	
ID-028	2.51-24	2.52-24	
ID-0G8	2.51-72	2.52-72	
WBA 22/23			
ID-003	3.09-42i	3.09-42i	
ID-024	3.09-40	3.09-40	



Figure 2: Canadian Polymer \$5.00 Bill (Front)
(SPECIMEN-NOT VALID FOR LEGAL TENDER)



Figure 3: Canadian Polymer \$10.00 Bill (Front)
(SPECIMEN-NOT VALID FOR LEGAL TENDER)

JCM TECHNICAL SUPPORT CONTACTS		
Headquarters (Japan)		
Sales and Service	+81-3-5962-3731	hq-jp@jcmglobal.com
Europe, Africa, Russia, Middle East		
Sales	+49-211-530645-50	hq-eu@jcmglobal.com
Service	+49-211-530645-60	
Australia, Oceania		
Sales and Service	+853 28 72 2684	asiapactechsupport@jcmglobal.com
Southeast Asia		
Sales and Service	+853 28 72 2684	asiapactechsupport@jcmglobal.com
North/South America/Canada/Caribbean		
Toll Free Product Support	(800) 683-7248 or (702) 651-0000	techsupport@jcmglobal.com
After Hours Americas Support		
<p>JCM American prides itself in offering the best Customer Service in the industry. We offer a 24 hour After Hours Hotline, where Technical Support Personnel can be reached at any time, 7 days a week. To reach our 24/7 After Hours Hotline:</p> <ol style="list-style-type: none"> 1.) Call JCM American at (800) 683-7248. 2.) Select "Option 1" and wait for the call to be transferred to the JCM after hours Technical Support line. 3.) Speak with a certified JCM Support Technician about your situation. 		

JCM is a registered trademark of JCM American Corporation. All other product names mentioned herein may be registered trademarks or trademarks of their respective companies. Furthermore, TM and ® are not mentioned in each case in this publication.